

shp 18/04

Date: Friday, 04/04/2008 9:24:15 AM  
User: Julie Lecocq

Process Sheet

Customer : CU-DAR001 Dart Helicopters Services Drawing Name : BK117 SKIDTUBE ASSEMBLY  
Job Number : 38413  
Estimate Number : 12899  
P.O. Number :  
This Issue : 04/04/2008 S.O. No. :  
Prsht Rev. : NC Part Number : D117762011  
First Issue : 04/04/2008 Type : LANDING GEAR Drawing Number : N/A  
Previous Run : 38412 Drawing Revision : A  
Material :  
Due Date : 18/04/2008 Qty: 1 Um: Each  
Written By :  
Checked & Approved By : JLD 08.04.4  
Comment : Est Rev:A 07.06.11 New Issue EC  
Est Rev:B 08-02-22 change to revA DD verified by:

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
1.0	DC	DOCUMENT CONTROL
<p>Comment: DOCUMENT CONTROL Photocopy bluefile &amp; type labels per PPP D135-751-011 CHG001</p> <p><i>Handwritten: JLD 08.04.4, 0806-27, 08/06/25</i></p>		
2.0	38413A	BK117 SKIDTUBE ASSEMBLY
<p>Comment: Sub-Component BK117 SKIDTUBE ASSEMBLY Batch: <u>38413 A</u></p>		
3.0	PACKAGING 1	PACKAGING RESOURCE #1
<p>Comment: PACKAGING RESOURCE #1 Pick Packing Kit</p>		
4.0	D35121	WEARPLATE
<p>Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s) WEARPLATE Batch: <u>B37618</u></p>		
5.0	AN900JD40L	Washer
<p>Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s) Washer Batch: <u>M104885</u></p> <p><i>Handwritten: AN960C10L see attached</i></p>		

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA:    Date: 28/06/20  
 QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 04/04/2008 9:24:15 AM  
User: Julie Lecocq

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: BK117 SKIDTUBE ASSEMBLY

Job Number: 38413

Part Number: D117762011

\*Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

6.0	AN3C4A	BOLT
-----	--------	------



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

BOLT

BATCH: M107376

7.0	AN451A	Bolt
-----	--------	------



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Bolt

BATCH: M106662

8.0	D2972	Bushing
-----	-------	---------



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Bushing

BATCH: B14103

9.0	MS21042L4	Nut
-----	-----------	-----



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Nut

BATCH: M106825

10.0	QC4	INSPECT 100% KITS FOR COMPLETENESS
------	-----	------------------------------------



Comment: INSPECT 100% KITS FOR COMPLETENESS

11.0	PACKAGING 1	PACKAGING RESOURCE #1
------	-------------	-----------------------



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D135-751-011

Location: \_\_\_\_\_

PPP Rev: \_\_\_\_\_

12.0	QC21	FINAL INSPECTION/W/O RELEASE
------	------	------------------------------



Comment: FINAL INSPECTION/W/O RELEASE

Job Completion



①  
D08106/26  
mf 08-06-26

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

## 32.9 PARTS LIST

Item	Qty -011	Qty -041	Qty -043	Qty -101	Part Number	Description
	X				D135-751-011	SKIDTUBE INSTALLATION
	1	X			D135-751-041	REPLACEMENT SKIDTUBE
			X		D135-751-043	WEARPLATE KIT
				X	D135-751-101	SKIDTUBE EXTENSION KIT
1		1			D3507-041	SKIDTUBE ASSEMBLY
2	4				**BRS8-96/48SZ-M8-W2	CLAMP
3	8				**LN9038-08032	SCREW
4		1			*D2965	CAP
5		1			*D2965-3	CAP
6		2			***AELS-1032-130	INSERT
7		2			***AELS-1032-225	INSERT
8		2			*AN3C5A	BOLT
9		2			*AN960C10L	WASHER
10		2			*AN526C1032-10	SCREW
20A		1	1		*D3508-1	WEARPLATE
20B		1	1		*D3558-1	GASKET
21A		1	1		*D3508-3	WEARPLATE
21B		1	1		*D3558-3	GASKET
22A		1	1		*D3508-5	WEARPLATE
22B		1	1		*D3558-5	GASKET
23A		1	1		*D3508-7	WEARPLATE
23B		1	1		*D3558-7	GASKET
24		38			*AELS-1032-130	INSERT
25	8	30	38		*AN3C4A	BOLT
26	8	30	38		*AN960C10L	WASHER
27	2		2		D3512-1	WEARPLATE
30		1			*AELS-1032-225	INSERT
31		1			*AN3C4A	BOLT
32		1			*AN960C10L	WASHER
40		4			*D3492-041	PLUG ASSEMBLY
41		4			***NAS1611-010	O-RING
42		2			*D3492-047	PLUG ASSEMBLY
43		2			***NAS1611-007	O-RING
44		4			*D3506-1	DOUBLER
45		8			*MS20601AD4W3	RIVET
46		2			*D3506-3	DOUBLER
47		4			*MS20601AD4W3	RIVET
48		4			*D3492-043	PLUG ASSEMBLY
49		4			***NAS1611-013	O-RING
50				1	D3510-041	INSERT ASSEMBLY
51				2	***AELS-1032-130	INSERT
52				6	***AELS-1032-225	INSERT
53				2	***ALS4-428-165	INSERT
54				2	AN4C7A	BOLT
55				2	AN960C416L	WASHER
56				2	AN3C4A	BOLT
57				8	AN3C7A	BOLT
58				10	AN960C10L	WASHER

\* PART IS INCLUDED WITH D3507-041 SKIDTUBE ASSEMBLY

\*\* TO BE SUPPLIED BY CUSTOMER, LISTED AS REFERENCE ONLY

\*\*\* DENOTES PART IS INCLUDED WITH ASSEMBLY ABOVE

• COPYRIGHT © 2006 BY DART AEROSPACE USA, INC. •

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.


SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
NO. 38413

32-00-00

30/04

Date: Friday, 04/04/2008 9:24:42 AM  
User: Julie Lecocq

Process Sheet
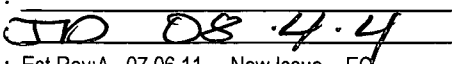
<b>Customer</b>	: CU-DAR001 Dart Helicopters Services	<b>Drawing Name</b>	: BK117 SKIDTUBE ASSEMBLY
<b>Job Number</b>	: 38413A		
<b>Estimate Number</b>	: 12898		
<b>P.O. Number</b>	:	<b>Part Number</b>	: D117762041
<b>This Issue</b>	: 04/04/2008	<b>S.O. No.</b>	:
<b>Prsht Rev.</b>	: NC	<b>Drawing Number</b>	: D3582 REV A
<b>First Issue</b>	: / /	<b>Project Number</b>	: N/A
<b>Previous Run</b>	: 38412A	<b>Drawing Revision</b>	: A
	<b>Type</b> : LANDING GEAR	<b>Material</b>	:
<b>Written By</b>	:	<b>Due Date</b>	: 18/04/2008
<b>Checked &amp; Approved By</b>			<b>Qty:</b> 1 <b>Um:</b> Each
<b>Comment</b>	: Est Rev:A 07.06.11 New Issue EO Prototype for engineering use only (LG0005-32910) Est Rev:B 08-02-22 change to revA as per dwg DD verified by:		

Additional Product

Job Number:



<b>Seq. #:</b>	<b>Machine Or Operation:</b>	<b>Description :</b>
----------------	------------------------------	----------------------

1.0	DC	DOCUMENT CONTROL
-----	----	------------------



**Comment:** DOCUMENT CONTROL

Photocopy bluefile & type labels per PPP D117-762-041 CHG001

2.0	D2962150	3.540 Outer Tube, Extrut
-----	----------	--------------------------



**Comment:** Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2962-150 Extrusion 25672 SL 8-4-7

3.0	SKIDTUBES 1	SKIDTUBESS RESOURCE 1
-----	-------------	-----------------------



**Comment:** LANDING GEAR RESOURCE 1

1-Determine square end of tube and deburr

2-Drill #30 pilot holes using DT8678. Do not open holes.

3- Deburr holes.

SL 8-4-7

4.0	BENDING	BENDING MACHINE - SKIDTUBES
-----	---------	-----------------------------



**Comment:** BENDING MACHINE

Bend tube as per program on CNC Bender and Dwg D3582. Use 5/16" locator pin on buggy "A".

SL 8-4-8

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: BK117 SKIDTUBE ASSEMBLY

Job Number: 38413A

Part Number: D117762041

Job Number:



Seq. #:

Machine Or Operation:

Description :

5.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Cut Fwd end of the tube using DT8185

DP 8-4-8

2-Cut Aft end at VC using DT8185

3-Deburr ends

4-Drill Aft Cap holes using DT8678 \*\*\*DO NOT OPEN AFT CAP HOLE\*\*\*

5-Locate DT 8973 & Drill Ground wire hole on top of Tube.

6-Install 3/16 cleco in Ground wire hole ,then drill all X-Bolt holes using 3/16" drill.

7-Drill pilot holes for wearplates using DT8974

8-Open wearplate holes and ground wire holes to Ø19/64" (0.297") as per Dwg D3582.

9-Open Aft Cap holes using .209" drill.

10-Deburr holes.

SL 8-4-8

6.0

D2964

Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Cap

Batch:

214101 BE 08/04/09

7.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Weld fwd cap D2964 per dwg D3582 and QSI 004

A/R AL ROD

Batch:

m106330 / m107263 BE 08/04/09

2-Grind flush

DP 8-4-9



W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: 04/04/2008 9:24:43 AM  
User: Julie Lecocq

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: BK117 SKIDTUBE ASSEMBLY

Job Number: 38413A

Part Number: D117762041

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

8.0	QC10	VISUAL INSPECTION OF GROUND WELDS
-----	------	-----------------------------------



Comment: VISUAL INSPECTION OF GROUND WELDS

PD 08-04-09 / 08/04/09 (H)

9.0	QC5	INSPECT WORK TO CURRENT STEP
-----	-----	------------------------------



Comment: INSPECT WORK TO CURRENT STEP

08/04/09 (H)

10.0	HAND FINISHING1	HAND FINISHING RESOURCE #1
------	-----------------	----------------------------



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

PD BE 08/04/10

11.0	QC3	INSPECT POWDER COAT/CHEMICAL CONVERSION
------	-----	---



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

BE 08/04/10

12.0	D2971	Cross Bolt Spacer
------	-------	-------------------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Cross Bolt Spacer

batch: B33221

BE 08/04/11

13.0	D2973	Cross Bolt Spacer
------	-------	-------------------



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Cross Bolt Spacer

Batch: B14636

BE 08/04/11

14.0	D36621	SPACER
------	--------	--------



Comment: Qty.: 3.0000 Each(s)/Unit Total : 3.0000 Each(s)

SPACER

batch: B37189

BE 08/04/11

15.0	D36623	SPACER
------	--------	--------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

SPACER

batch: B37190

BE 08/04/11

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 04/04/2008 9:24:43 AM  
User: Julie Lecocq

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: BK117 SKIDTUBE ASSEMBLY

Job Number: 38413A

Part Number: D117762041

Job Number:



Seq. #:

Machine Or Operation:

Description :

16.0

D35841

WEB



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)  
WEB

B38411

DP 8-4-10

17.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open X-Bolt holes to .750"(4Places) as per Dwg D3582, section B-B

2-Counter Sink X-BOLT holes as per Dwg D3582

3-Deburr and blow out chips from inside of tube.

4-Bond web as per Dwg D3582 & QSI 015

A/R 241 Sike Flex

Batch:

M107397

Exp Date:

8-10-30

DP 8-4-10

5-Weld x-bolt spacers(D2973) as per Dwg D3582 section B-B.

A/R AL ROD

Batch:

M107263

6-Grind welds flush

M 8-4-12

Tools: E

18.0

QC10

VISUAL INSPECTION OF GROUND WELDS



Comment: VISUAL INSPECTION OF GROUND WELDS

RD 08-04-14 / 08/04/14 (X)

19.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

08/04/14 (X)

20.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat White Gloss (Ref: 4.3.5.1) as per QSI 005 4.3

PRESS WASH  
M107550

BR 08-04-15 (X)

M. 08/04/15

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Friday, 04/04/2008 9:24:43 AM  
User: Julie Lecocq

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: BK117 SKIDTUBE ASSEMBLY

Job Number: 38413A

Part Number: D117762041

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

21.0	QC3	INSPECT POWDER COAT/CHEMICAL CONVERSION
------	-----	---



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

08-04-18

(X)

22.0	AELS1032130	INSERT
------	-------------	--------



Comment: Qty.: 36.0000 Each(s)/Unit Total : 36.0000 Each(s)

Insert

Batch:

M105855

23.0	ALS4428165	Inserts
------	------------	---------



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Inserts

batch

M6989

\*\*\*same as ALS7-428-165 QSI 0017 \*\*\*

24.0	HAND FINISHING1	HAND FINISHING RESOURCE #1
------	-----------------	----------------------------



Comment: HAND FINISHING RESOURCE #1

Install Wearplate & Ground Wire inserts as per Dwg D3582.

M.L.

08/04/18

(IX)

25.0	QC5	INSPECT WORK TO CURRENT STEP
------	-----	------------------------------



Comment: INSPECT WORK TO CURRENT STEP

Inspect Inserts

ala 5 08/04/18

26.0	D2965	Cap
------	-------	-----



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Cap

Batch:

B38605

\*

M.L.

27.0	D35083	WEARPLATE
------	--------	-----------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARPLATE

Batch:

B38431

M.L.

08/04/18

(IX)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Friday, 04/04/2008 9:24:43 AM  
User: Julie Lecocq

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: BK117 SKIDTUBE ASSEMBLY

Job Number: 38413A

Part Number: D117762041

Job Number:



Seq. #:

Machine Or Operation:

Description :

28.0

D35089

WEARPLATE



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARPLATE

Batch:

B 36417

M. L.

29.0

D350811

WEARPLATE



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Batch:

WEARPLATE

B 36415

M. L.

30.0

D350813

WEARPLATE



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARPLATE

Batch:

B 36416

M. L.

31.0

D35583

GASKET



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

GASKET

Batch:

B 38613

M. L.

32.0

D35589

GASKET



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

GASKET

Batch:

B 36420

M. L.

33.0

D355811

GASKET



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

GASKET

Batch:

B 36419

M. L.

34.0

D355813

GASKET



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

GASKET

Batch:

B 36418

M. L.

08/04/18

(1X)



W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Friday, 04/04/2008 9:24:43 AM  
User: Julie Lecocq

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: BK117 SKIDTUBE ASSEMBLY

Job Number: 38413A

Part Number: D117762041

Job Number:



Seq. #:

Machine Or Operation:

Description :

35.0

AN3C4A

BOLT



Comment: Qty.: 28.0000 Each(s)/Unit Total : 28.0000 Each(s)

BOLT

Batch:

M 107376

m.h

36.0

AN3C5A

Bolt



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Bolt

Batch:

M 106780

m.h

37.0

AN44A

Bolt



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Bolt

batch

M 101291

m.h

38.0

AN960C10L

washer



Comment: Qty.: 28.0000 Each(s)/Unit Total : 28.0000 Each(s)

washer

Batch:

M 107376

m.h

39.0

AN960JD10L

Washer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Washer

batch

M 104885

m.h

40.0

AN960JD416L

Washer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Washer

batch

M 107008

m.h

41.0

D3492049

PLUG ASSEMBLY



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

PLUG ASSEMBLY

batch

B 37288

m.h 08/04/18

(IX)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 04/04/2008 9:24:43 AM  
User: Julie Lecocq

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: BK117 SKIDTUBE ASSEMBLY

Job Number: 38413A

Part Number: D117762041

Job Number:



Seq. #:

Machine Or Operation:

Description :

42.0

D3492051

PLUG ASSEMBLY



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

PLUG ASSEMBLY

batch

B37289

M-L

43.0

D3492053

PLUG ASSEMBLY



Comment: Qty.: 6.0000 Each(s)/Unit Total: 6.0000 Each(s)

PLUG ASSEMBLY

batch

B38430

M-L

44.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Inspect for Foreign objects

2-Install Aft cap as per Dwg D3582, Detail "C"

A/R 241 Sika Flex Batch:

Exp Date:

M107397

08/10

3-Install Wearplates as per Dwg D3582,

Note:Install Bolt and washer on Ground Wire inserts on top of tube see section

\*\*\*\*\*Do not install bolts where indicated on Dwg(Note #6)\*\*\*\*\*

A/R 241 Sika Flex Batch:

Exp Date:

M107397

08/10

D-D of dwg D3582

08/04/18

M-L

4- Wing Walk as per Dwg D3043 and QSI 005 4.4

m106894

FL 08/04/21

45.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

S 08/04/21 (4)

46.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D117-762-041

Location:

PPP Rev:

PPP 38413

08/04/21

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes ☒ No ☐ DQA: ☒ ☐ Date: 08/04/26  
 QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Friday, 04/04/2008 9:24:43 AM  
User: Julie Lecocq

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: BK117 SKIDTUBE ASSEMBLY

Job Number: 38413A

Part Number: D117762041

Job Number:



Seq. #:


Machine Or Operation:

Description :

47.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

①  
A 08/06/26  
MF 08-06-26

Job Completion



W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries


# PARTS LIST FOR D3582-041 SKIDTUBE ASSEMBLY

Qty	Part Number	Description
X	D3582-041	SKIDTUBE ASSEMBLY
1	D2962-150	EXTRUSION
1	D2964	CAP
1	D2965	CAP
1	D2971	CROSS BOLT SPACER
2	D2973	CROSS BOLT SPACER
2	D3492-049	PLUG ASSEMBLY
2	D3492-051	PLUG ASSEMBLY
6	D3492-053	PLUG ASSEMBLY
1	D3508-3	WEARPLATE
1	D3508-9	WEARPLATE
1	D3508-11	WEARPLATE
1	D3508-13	WEARPLATE
1	D3558-3	GASKET
1	D3558-9	GASKET
1	D3558-11	GASKET
1	D3558-13	GASKET
1	D3584-1	WEB
3	D3662-1	CROSS BOLT SPACER
1	D3662-3	CROSS BOLT SPACER
36	AELS-1032-130	INSERT
2	ALS7-428-165	INSERT
28	AN3C4A	BOLT
2	AN3-5A	BOLT
2	AN4-4A	BOLT
28	AN960C10L	WASHER
2	AN960JD10L	WASHER
2	AN960JD416L	WASHER


## GENERAL NOTES:

- ALL DIMENSIONS ARE IN INCHES
- TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- WELDING TO BE DONE PER DART QSI 004.
- INSERT D3584-1 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241/-291 ADHESIVE PER DART QSI 015 AFTER BENDING.
- USE DART DRILL TEMPLATE DT8900 TO LOCATE AND DRILL Ø0.297 HOLES (36 PLACES) FOR WEARSHOE INSERTS. INSTALL AELS-1032-130 PER SECTION G-G (36 PLACES) AFTER FINISH. SEAL WEARPLATE BOLTS WITH SIKAFLEX-241/-291.
- DO NOT INSTALL AN3C4A BOLTS AND AN960C10L WASHERS IN INDICATED LOCATIONS.
- FINISH:
  - CHEMICAL CONVERSION COAT PER DART QSI 005 4.1 PRIOR TO INSERTING D3584-1 WEB.
  - POWDER COAT ASSEMBLY GLOSS WHITE (REF 4.3.5.1) PER DART QSI 005 4.3.
  - ANTI-SKID PAINT AS INDICATED TO 1.00 ABOVE CENTER LINE PER DART QSI 005 4.4


SHOP COPY  
 RETURN TO  
 ENGINEERING  
 UNCONTROLLED COPY  
 SUBJECT TO AMENDMENT  
 WITHOUT NOTICE  
 WORK ORDER  
 NO. 38413A

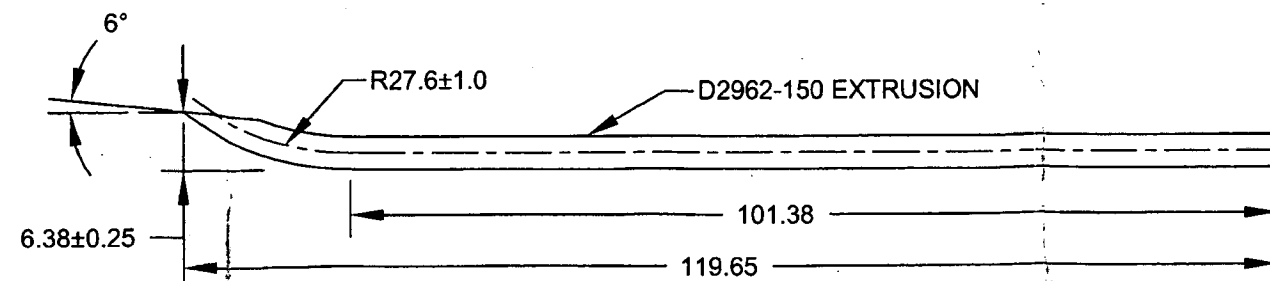


D3582-1 BENDING AND CUTTING DETAIL

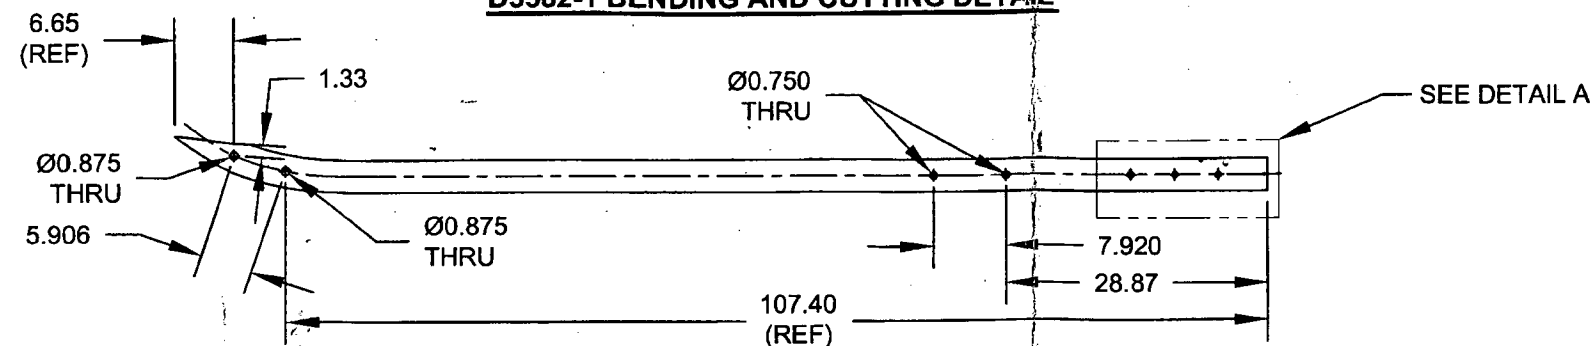

D3582-1 DRILLING DETAIL

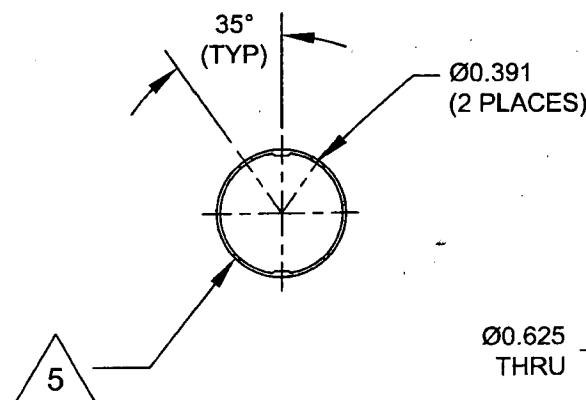

SECTION B-B  
SCALE 1:5

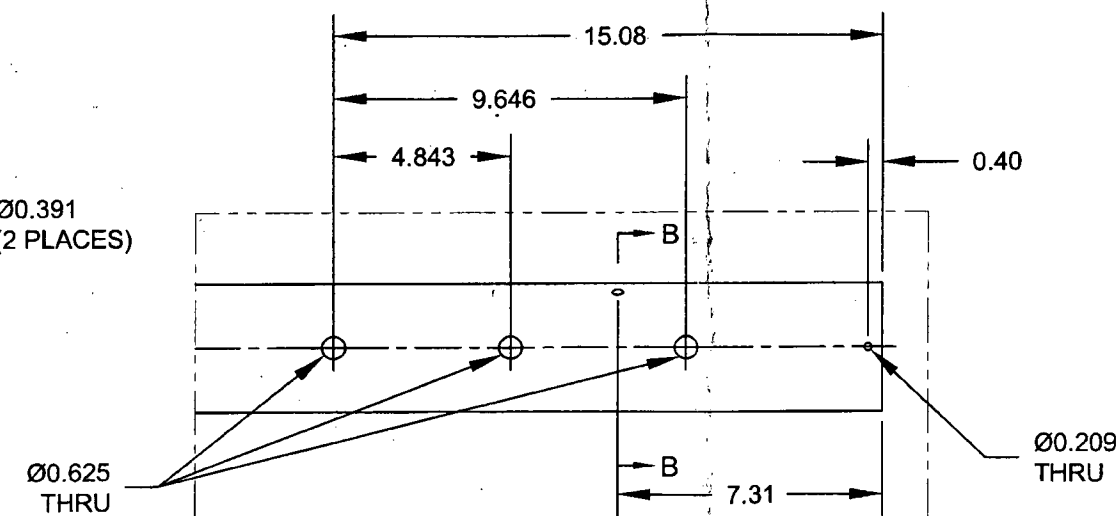


DETAIL A  
SCALE 1:5

RELEASED  
 07.11.22

A	NEW ISSUE	PH	07.06.08
REV.	DESCRIPTION	BY	DATE
DESIGN	PA	<b>DART AEROSPACE USA, INC</b> PORT HADLOCK, WA	
DRAWN	PA		
CHECKED	PA	DRAWING NO.	REV. A
MFG. APPR.	PA	D3582	SHEET 1 OF 2
APPROVED	PA	TITLE	SCALE
DE APPR.	PA	BK 117 SKIDTUBE ASSEMBLY	1:20
DATE	07.06.08	COPYRIGHT © 2007 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	





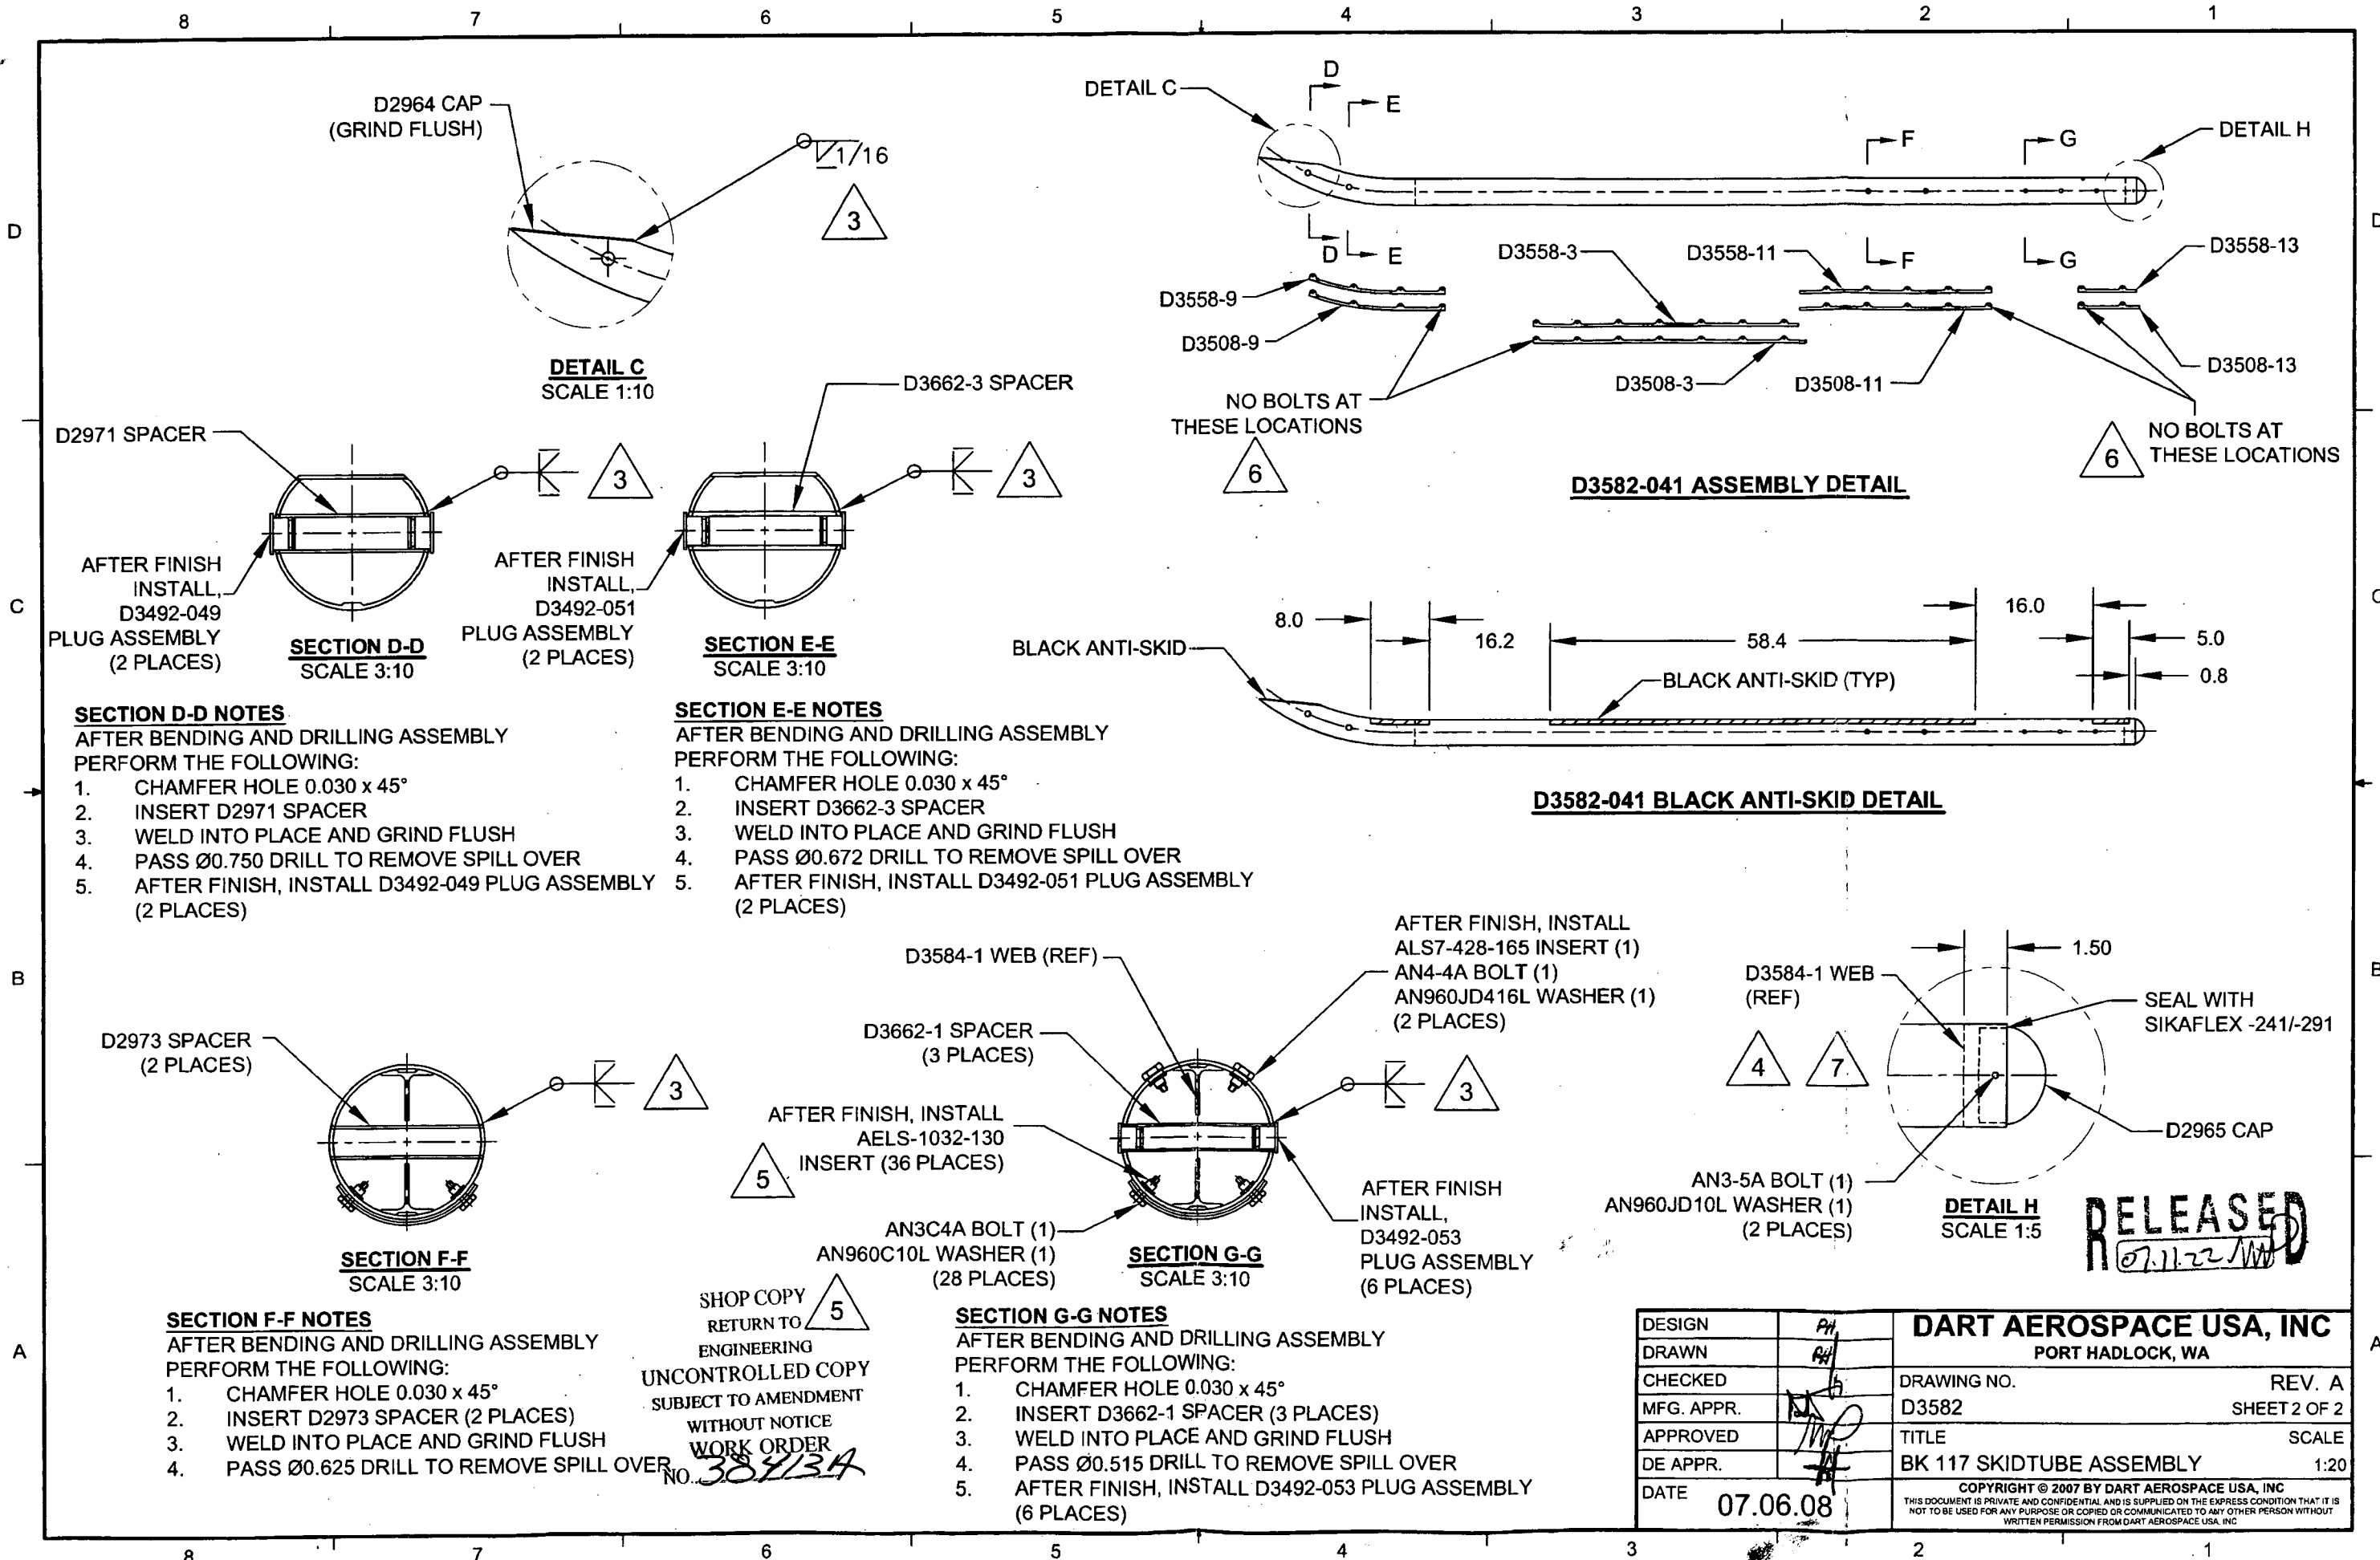

- SECTION D-D NOTES**  
AFTER BENDING AND DRILLING ASSEMBLY PERFORM THE FOLLOWING:
1. CHAMFER HOLE 0.030 x 45°
  2. INSERT D2971 SPACER
  3. WELD INTO PLACE AND GRIND FLUSH
  4. PASS Ø0.750 DRILL TO REMOVE SPILL OVER
  5. AFTER FINISH, INSTALL D3492-049 PLUG ASSEMBLY (2 PLACES)

- SECTION E-E NOTES**  
AFTER BENDING AND DRILLING ASSEMBLY PERFORM THE FOLLOWING:
1. CHAMFER HOLE 0.030 x 45°
  2. INSERT D3662-3 SPACER
  3. WELD INTO PLACE AND GRIND FLUSH
  4. PASS Ø0.672 DRILL TO REMOVE SPILL OVER
  5. AFTER FINISH, INSTALL D3492-051 PLUG ASSEMBLY (2 PLACES)

- SECTION F-F NOTES**  
AFTER BENDING AND DRILLING ASSEMBLY PERFORM THE FOLLOWING:
1. CHAMFER HOLE 0.030 x 45°
  2. INSERT D2973 SPACER (2 PLACES)
  3. WELD INTO PLACE AND GRIND FLUSH
  4. PASS Ø0.625 DRILL TO REMOVE SPILL OVER

- SECTION G-G NOTES**  
AFTER BENDING AND DRILLING ASSEMBLY PERFORM THE FOLLOWING:
1. CHAMFER HOLE 0.030 x 45°
  2. INSERT D3662-1 SPACER (3 PLACES)
  3. WELD INTO PLACE AND GRIND FLUSH
  4. PASS Ø0.515 DRILL TO REMOVE SPILL OVER
  5. AFTER FINISH, INSTALL D3492-053 PLUG ASSEMBLY (6 PLACES)

SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
NO. 384134

DESIGN	PH	<b>DART AEROSPACE USA, INC</b>	
DRAWN	PH	PORT HADLOCK, WA	
CHECKED	h	DRAWING NO.	REV. A
MFG. APPR.	MP	D3582	SHEET 2 OF 2
APPROVED	TH	TITLE	SCALE
DE APPR.		BK 117 SKIDTUBE ASSEMBLY	1:20
DATE	07.06.08	COPYRIGHT © 2007 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC	



NO. 148

AWS D17.1.2001  
QUALIFICATION TEST RECORD

Name: Barclay Elliot  
Job number: 38388A  
Part number: D117 762 oil  
Description: Skid tube Bk117  
Welding Process: Tig[ ☒ ] Mig[ ☐ ]  
Base material: Aluminium  
Current: AC[ ☒ ] DC[ ☐ ]

TEST REQUIREMENTS AND RESULTS

Visual: pass[ ☒ ] fail[ ☐ ]  
Penetration: pass[ ☒ ] fail[ ☐ ]

UNACCEPTABLE

Cracks: pass[ ☒ ] fail[ ☐ ]  
Undercut: pass[ ☒ ] fail[ ☐ ]  
Pin holes: pass[ ☒ ] fail[ ☐ ]  
Overlap (cold lap): pass[ ☒ ] fail[ ☐ ]  
Porosity (surface): pass[ ☒ ] fail[ ☐ ]  
Coloration: pass[ ☒ ] fail[ ☐ ]

Qualifier Pd. Duval Date of Test Coupon 08-04-14  
Welder Barclay Elliot Date of Test Coupon 08-04-14

The above named individual is qualified in accordance with AWS D17.1.2001 to weld